



REPORT

## Appendix II Cosira Sleaford (912548) and East Road Sleaford (912807) Protection Result Plots


Private and confidential

Prepared for: WPD

Project No: 109250  
Document Version: 1.0  
Date: 11 October 2018

**Cosira Sleaford (912548) and East Road Sleaford (912807) Study 01**

Phase fault at LV\_Branch\_A2: 3614.01A - curves plotted at 0.433kV

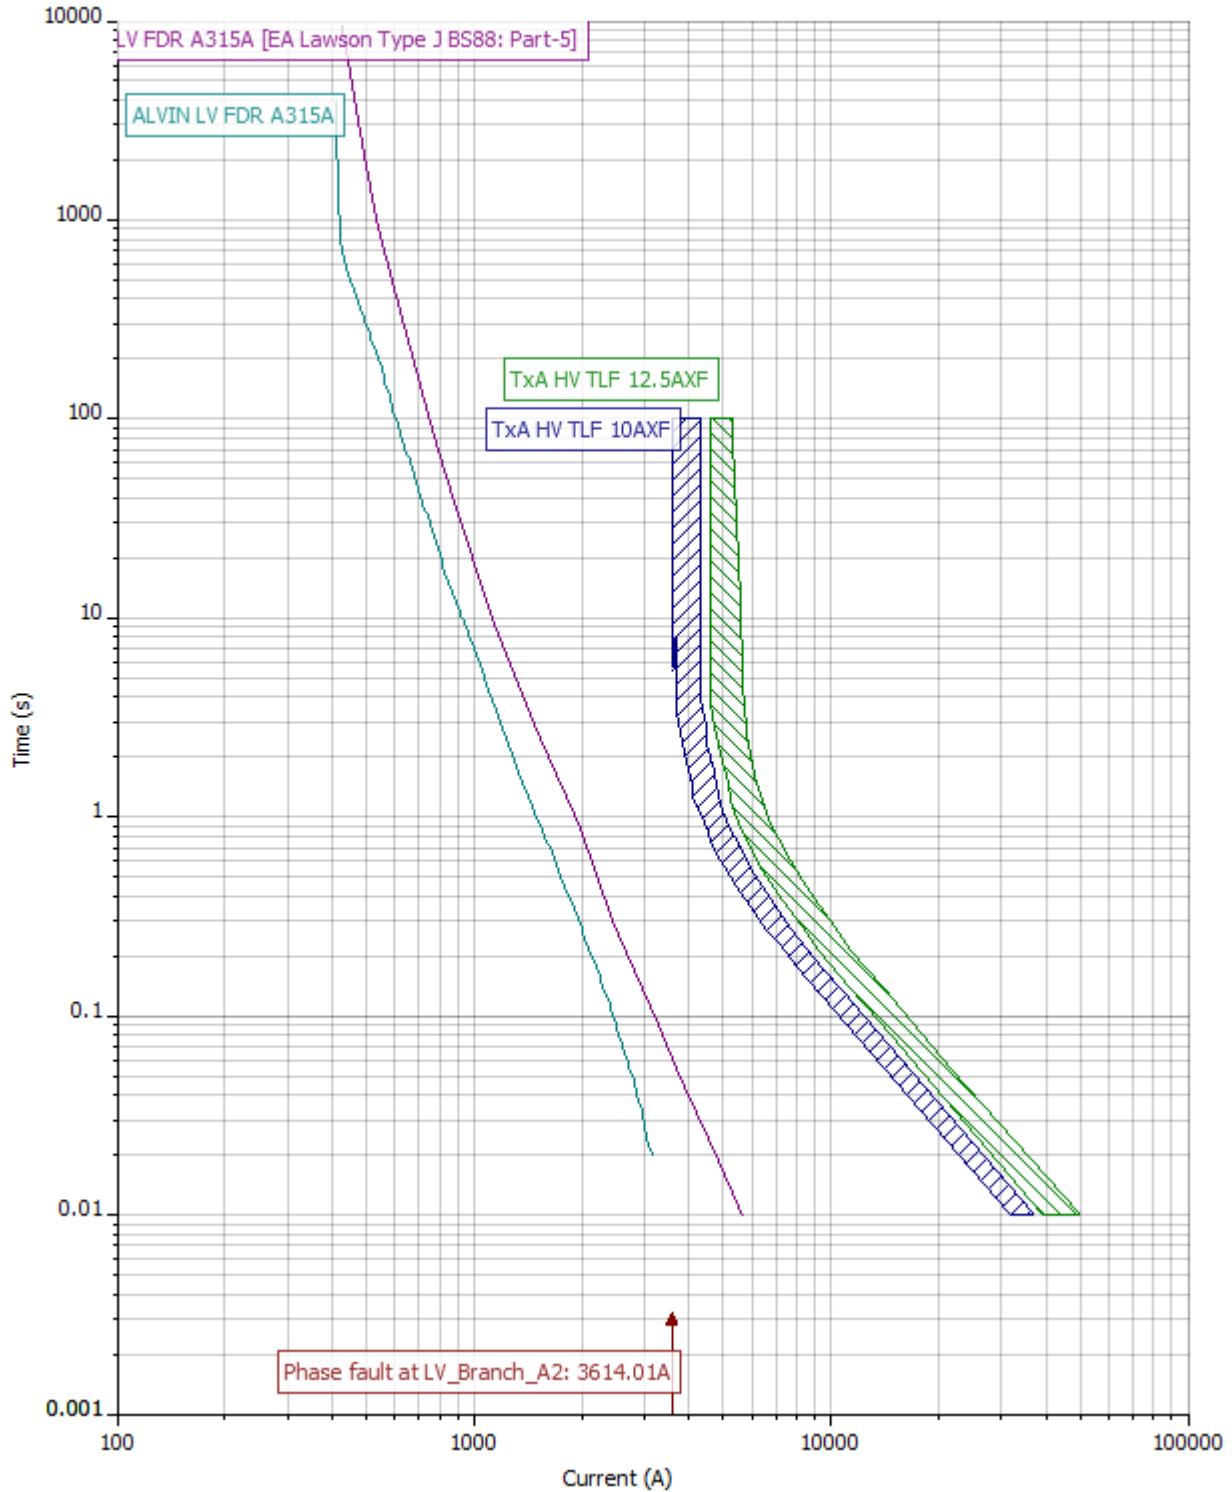

Protection Device	Current Seen (A)	Time (s)	Delta (s)
ALVIN LV FDR A 315A	3614	0.020	
LV FDR A 315A [ BS88: Part-5 ]		0.061	0.041

