



REPORT

Appendix III Canefields Ave (332853) and Letherton Close (332770) Protection Result Plots


Private and confidential

Prepared for: WPD

Project No: 109250
Document Version: 1.0
Date: 11 October 2018

Canefields Ave (332853) and Letherton Close (332770) Study 01


Phase fault at LV_Branch_A1: 3314.58A - curves plotted at 0.433kV

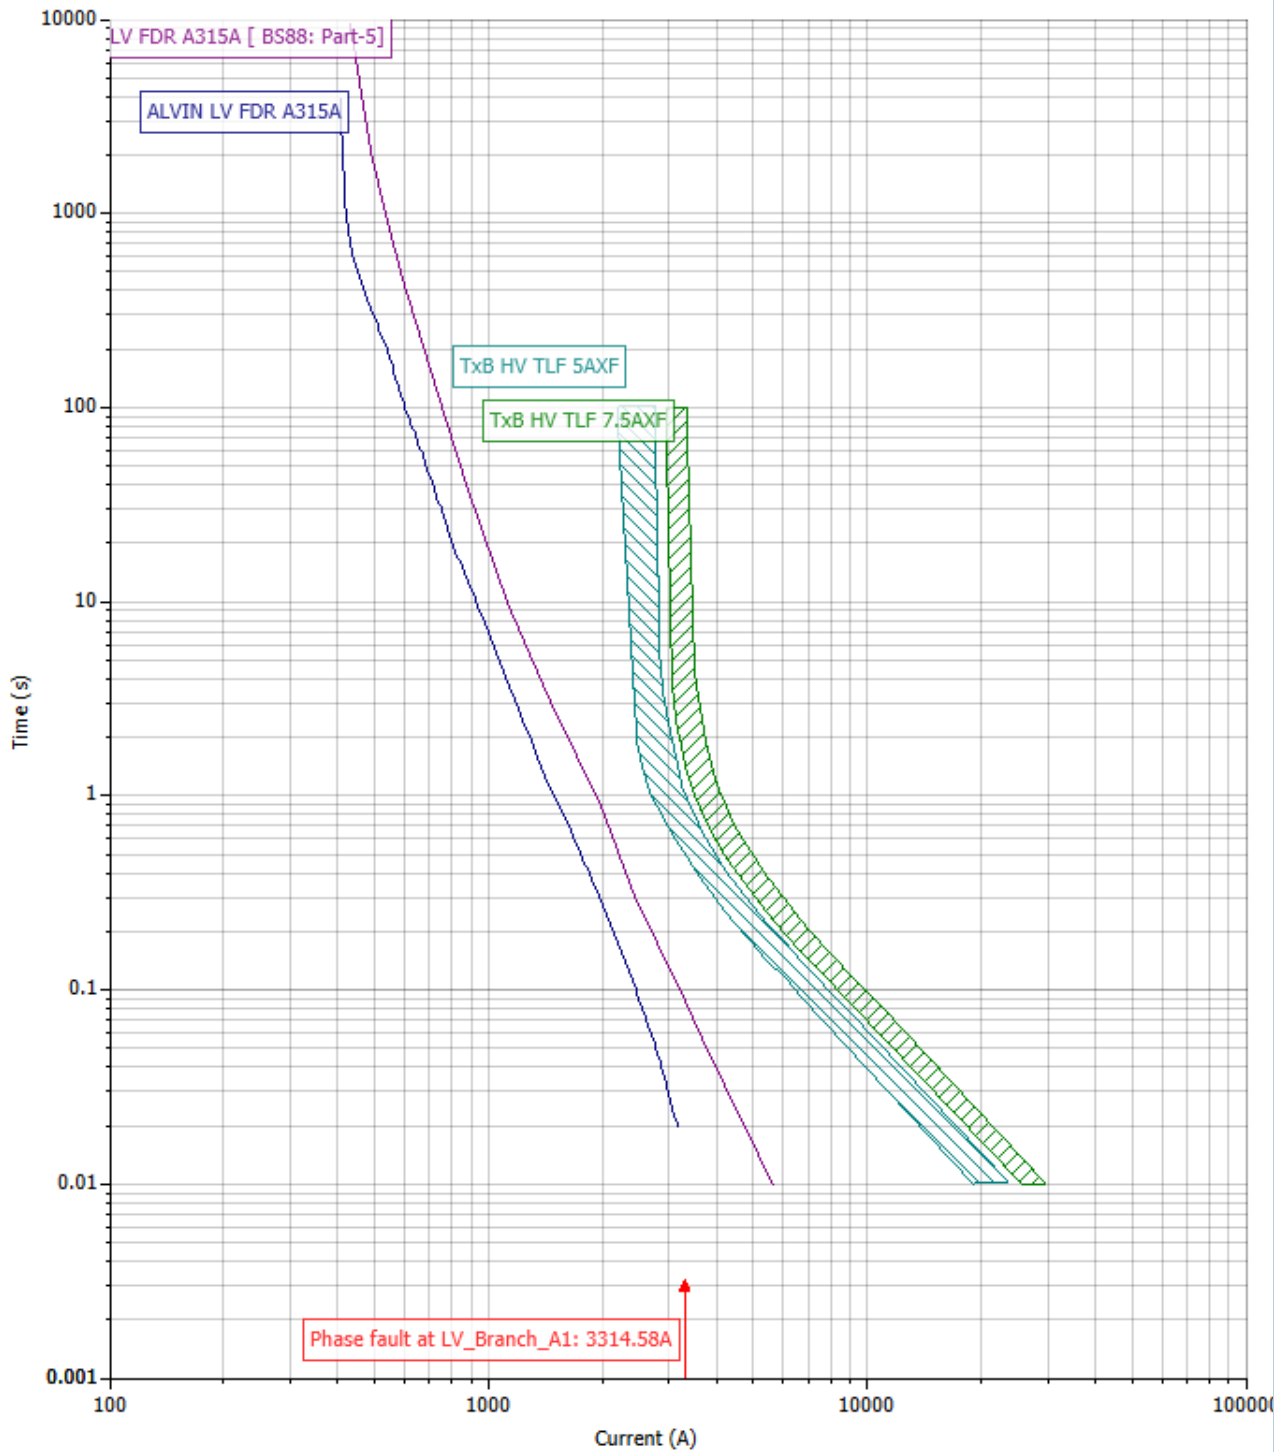


Protection Device	Current Seen (A)	Time (s)	Delta (s)
ALVIN LV FDR A315A	3315	0.020	
LV FDR A315A [BS88: Part-5]		0.089	0.069

Canefields Ave (332853) and Letherton Close (332770) Study 02

Phase fault at LV_Branch_B2: 1989.17A - curves plotted at 0.433kV

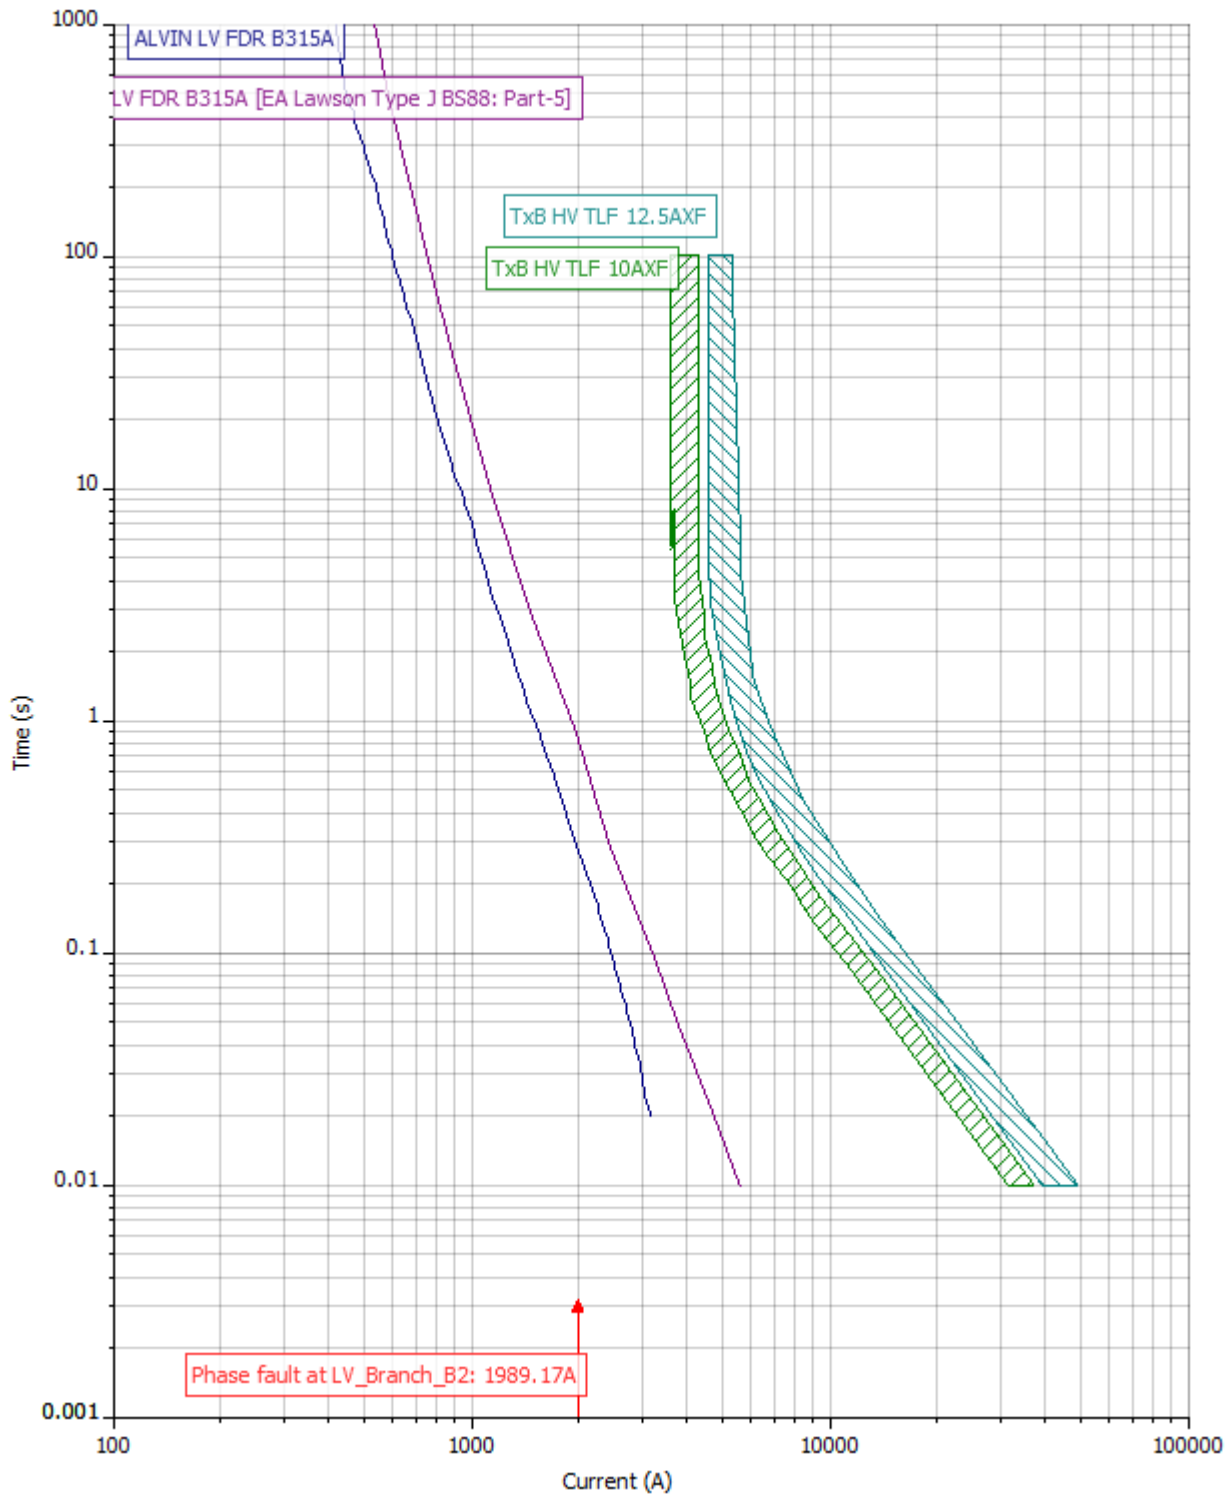


Protection Device	Current Seen (A)	Time (s)	Delta (s)
ALVIN LV FDR B 315A	1989	0.286	
LV FDR B 315A [BS88: Part-5]		0.872	0.586

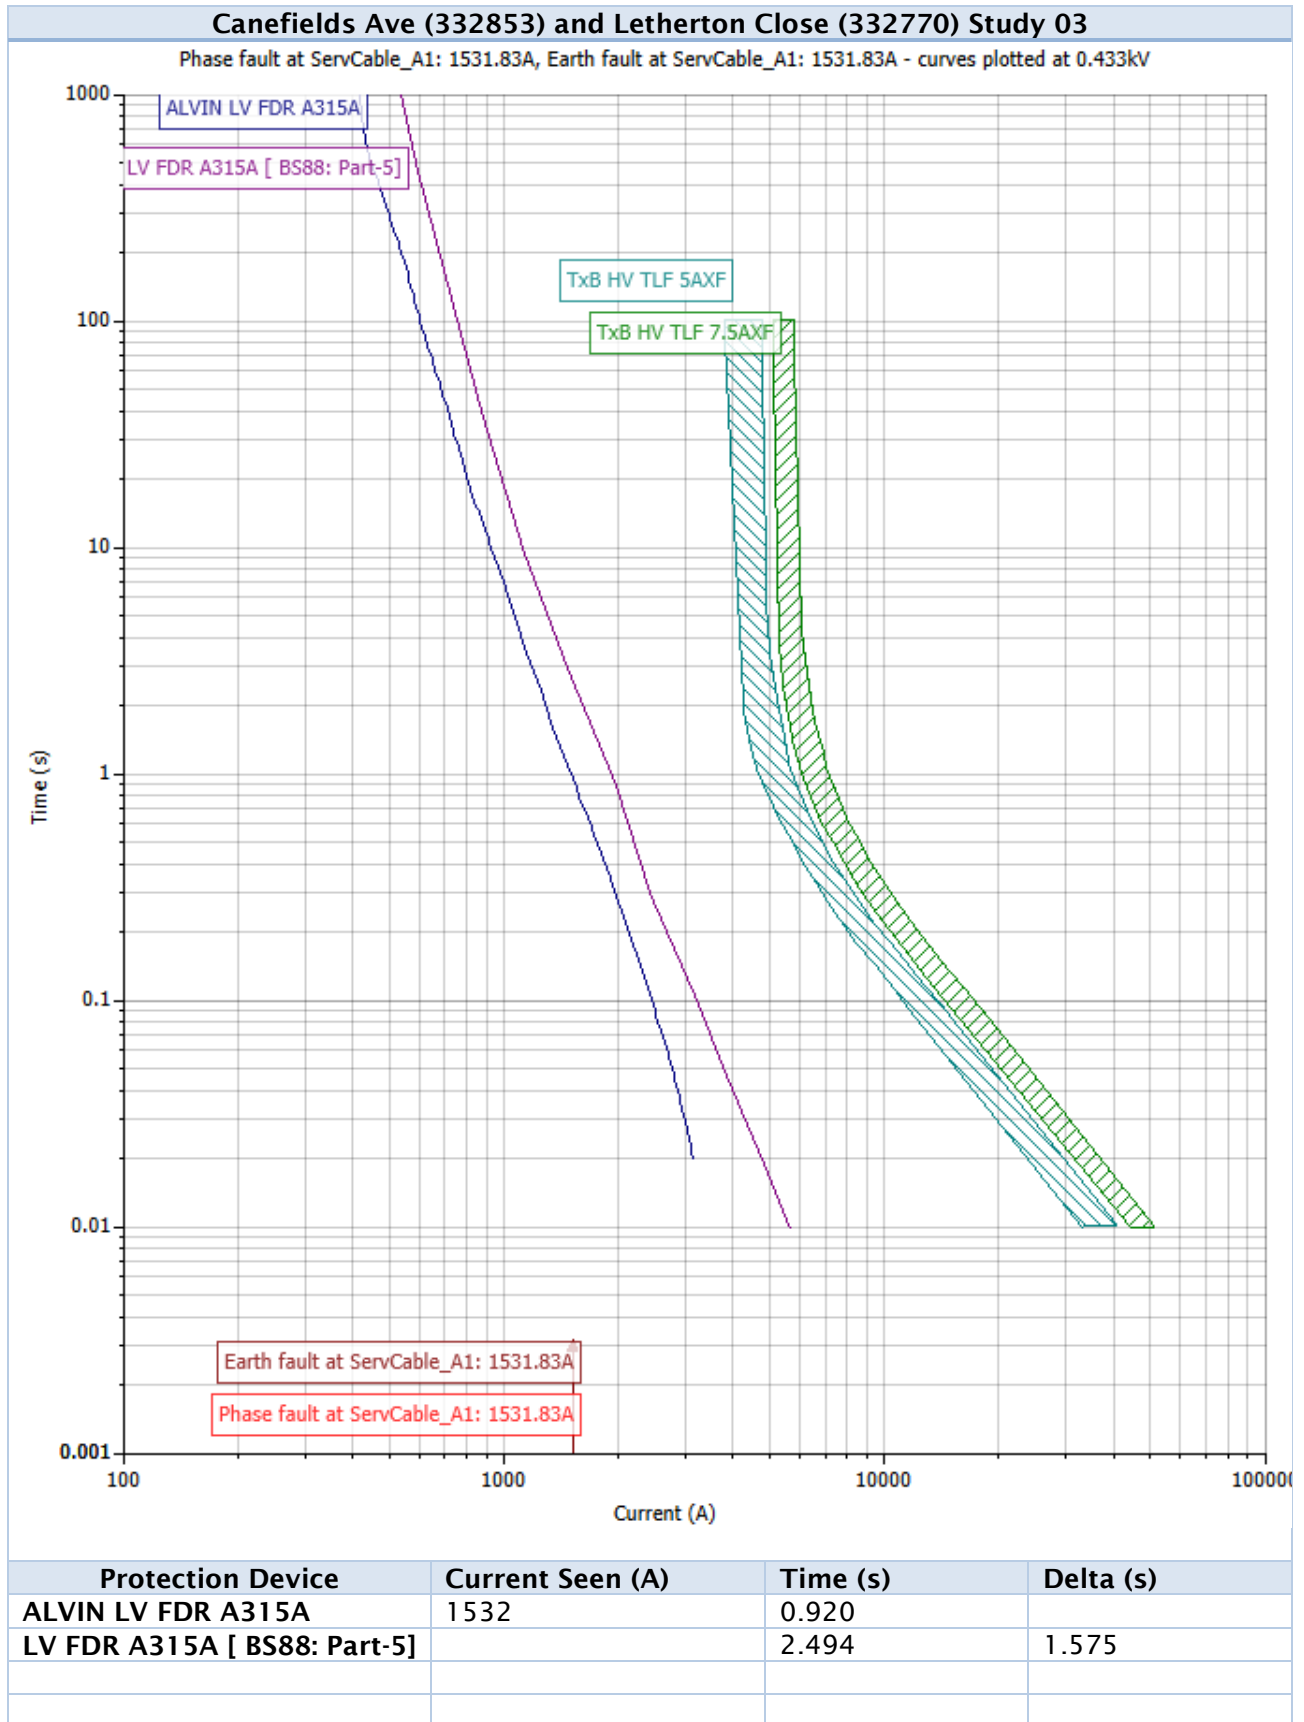

Canefields Ave (332853) and Letherton Close (332770) Study 04


Phase fault at ServCable_B2: 962.136A, Earth fault at ServCable_B2: 962.136A - curves plotted at 0.433kV

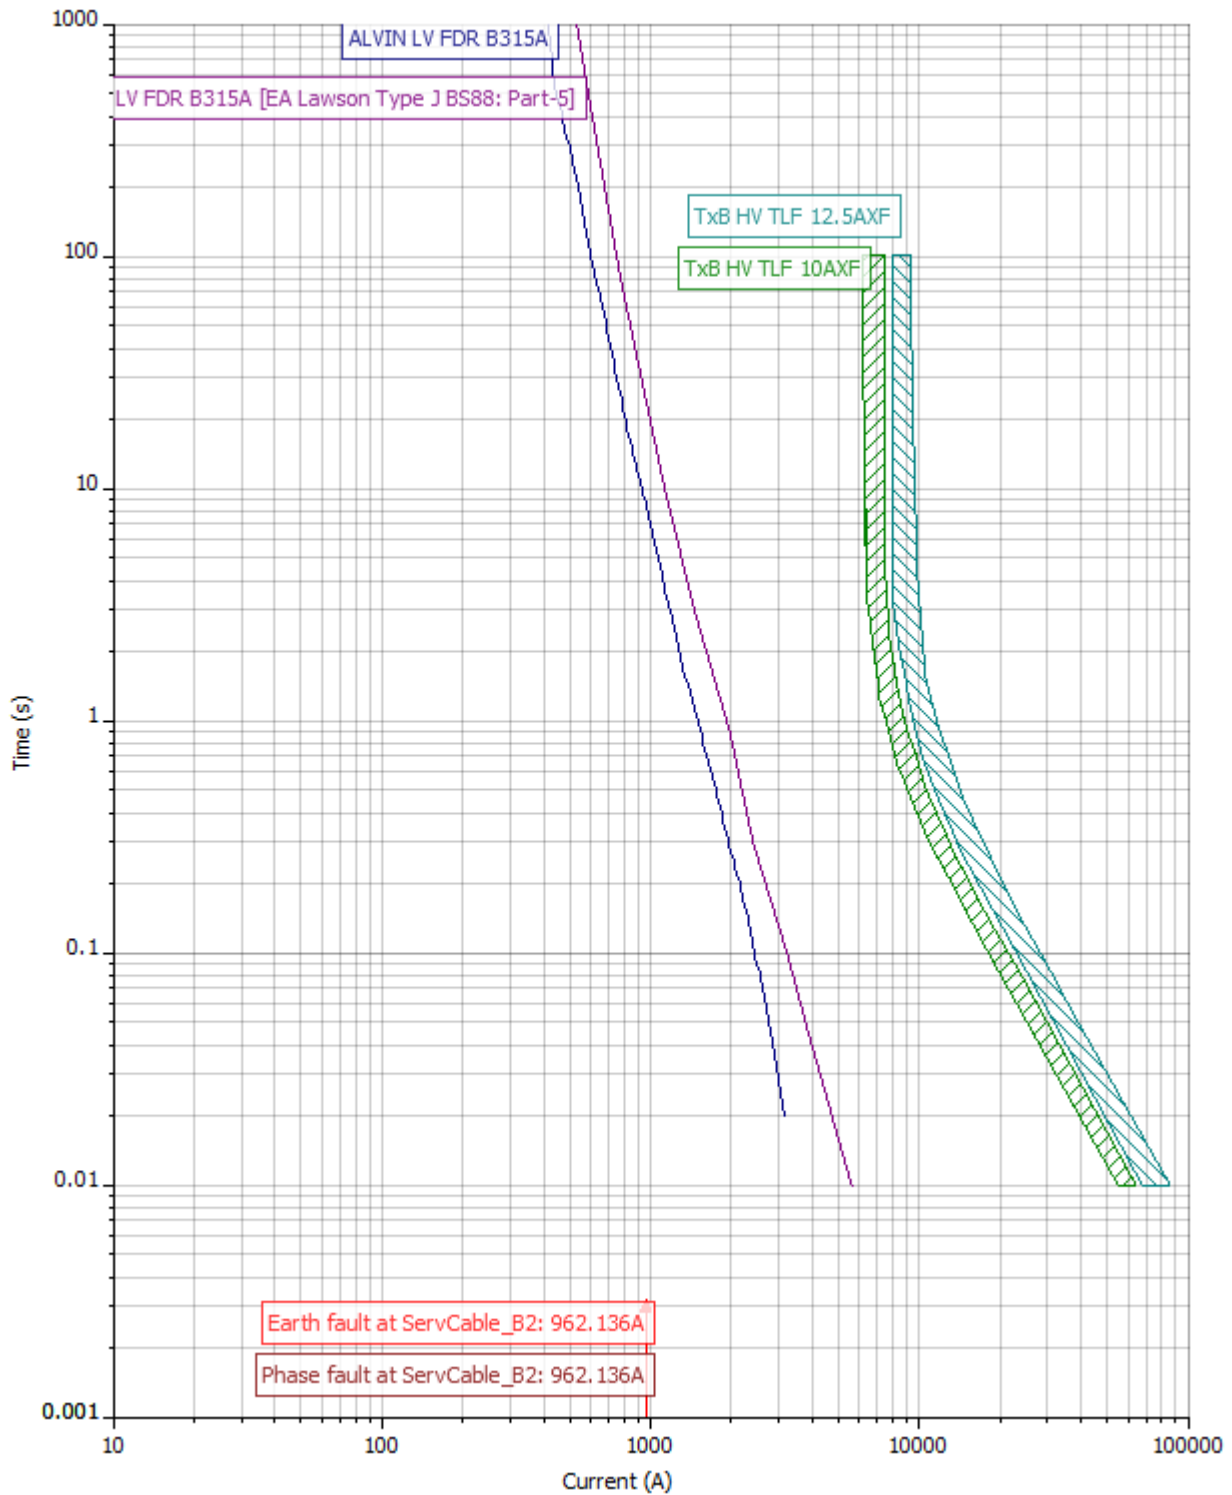

Protection Device	Current Seen (A)	Time (s)	Delta (s)
ALVIN LV FDR B 315A	962	8.623	
LV FDR B 315A [BS88: Part-5]		23.916	15.293


Canefields Ave (332853) and Letherton Close (332770) Study 05

Phase fault at LV_JNT_B1: 2920.64A - curves plotted at 0.433kV

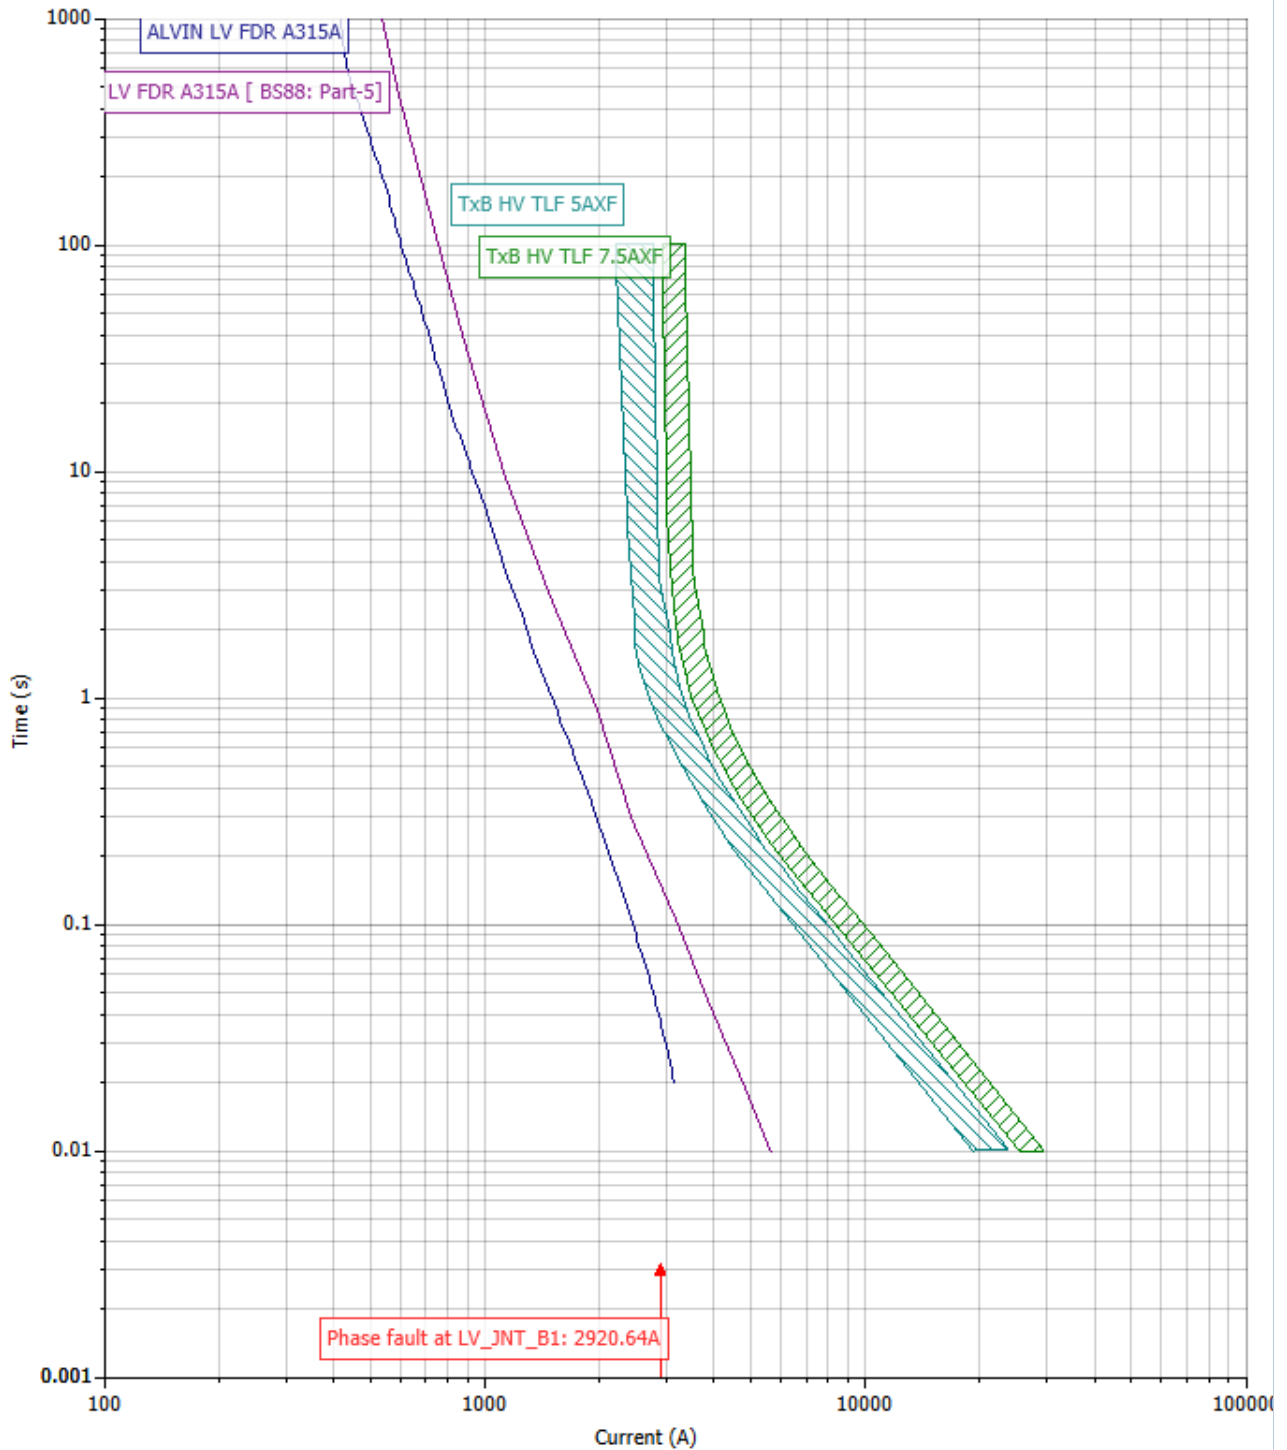


Phase fault at LV_JNT_B1: 2920.64A

Protection Device	Current Seen (A)	Time (s)	Delta (s)
ALVIN LV FDR A315A	2921	0.036	
LV FDR A315A [BS88: Part-5]		0.147	0.111

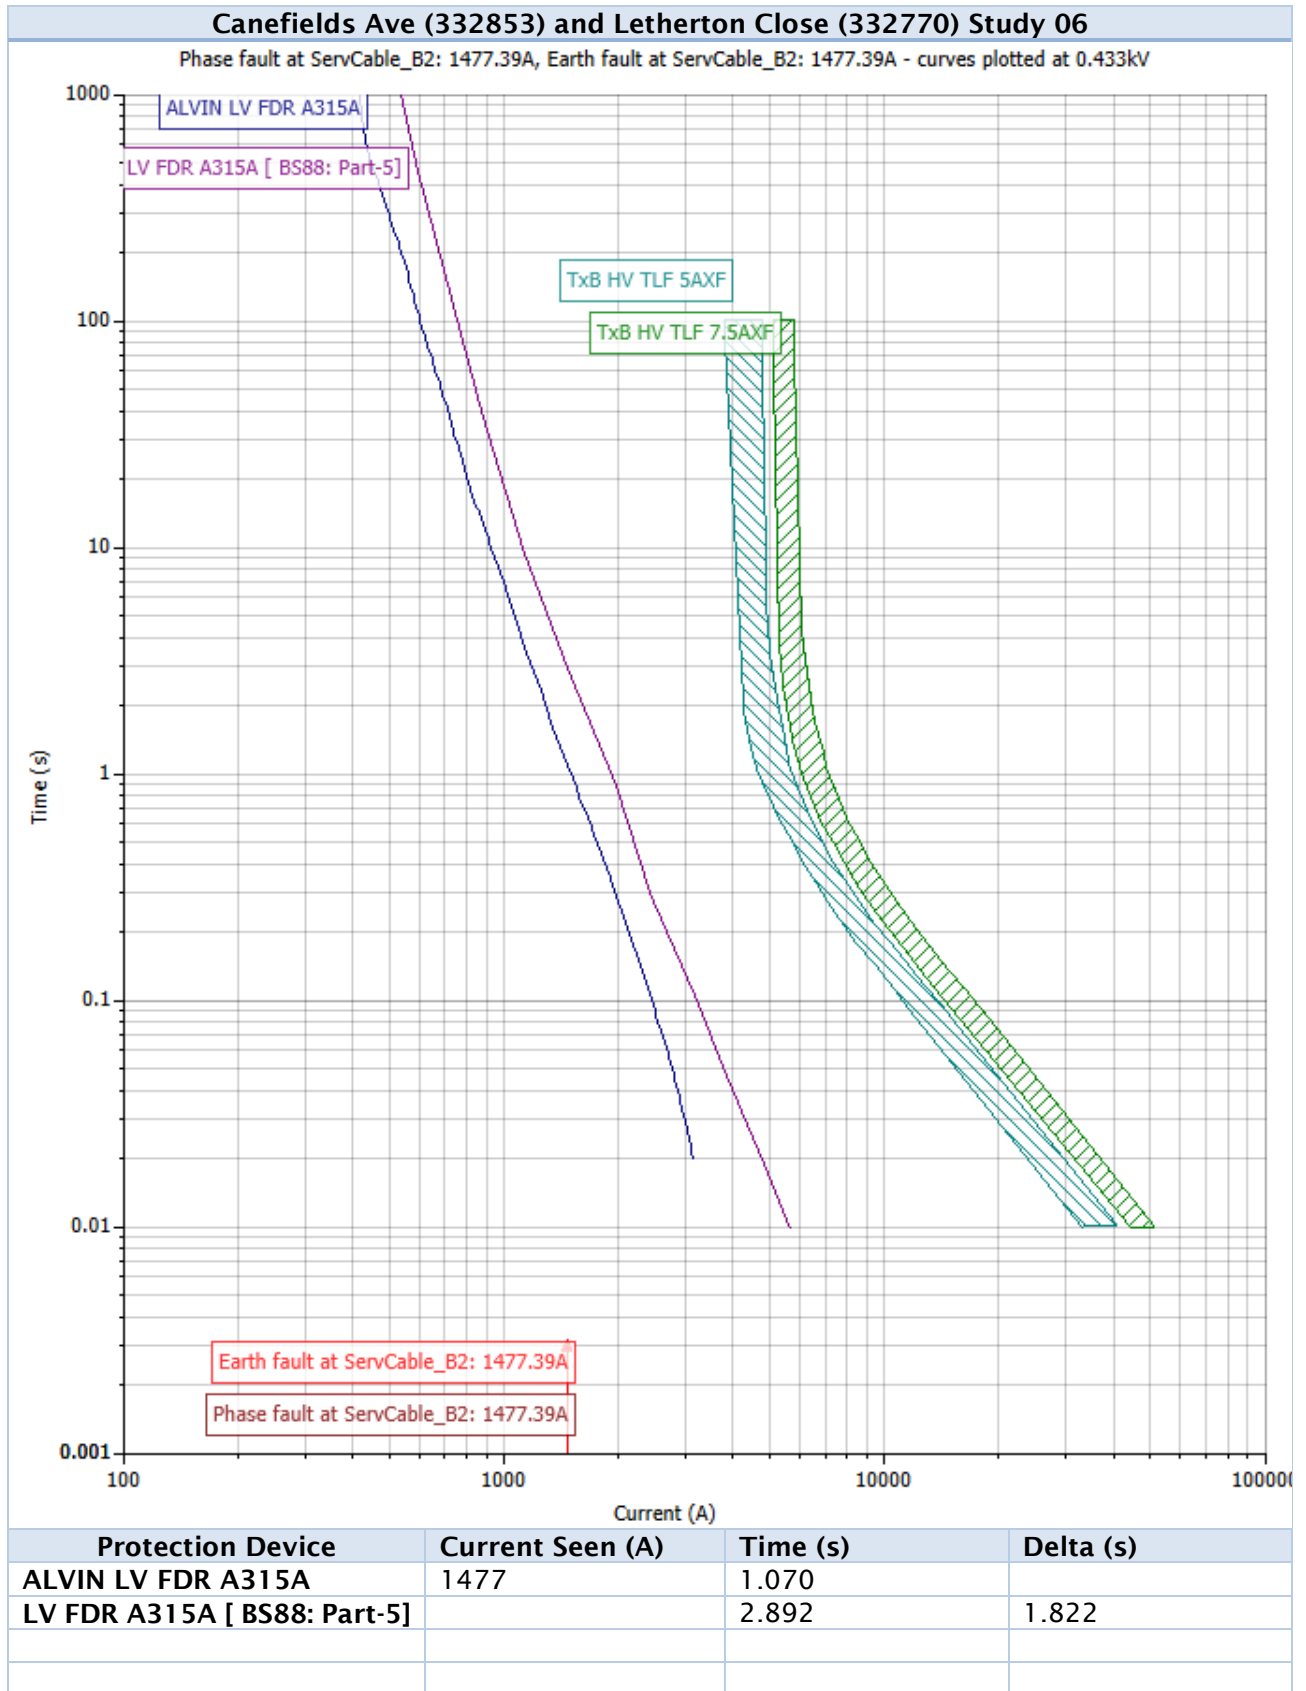

Canefields Ave (332853) and Letherton Close (332770) Study 07


Phase fault at LV_Branch_A1: 1808.39A - curves plotted at 0.433kV

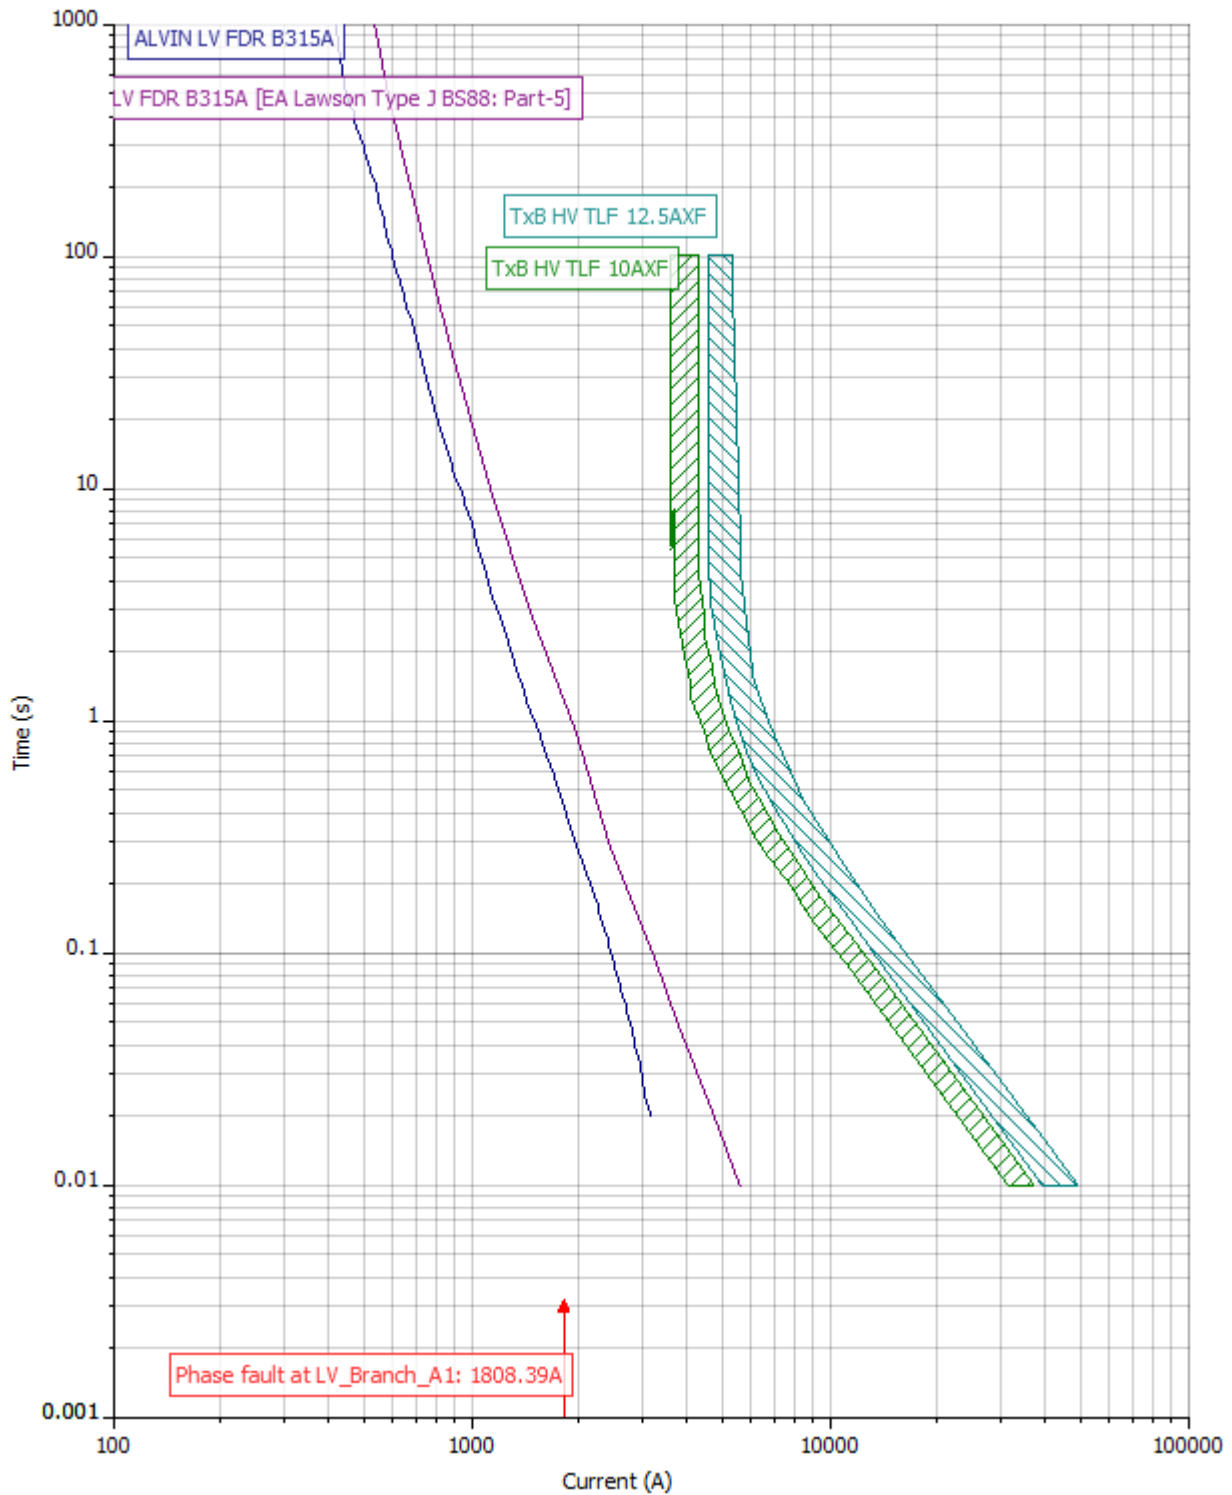

Protection Device	Current Seen (A)	Time (s)	Delta (s)
ALVIN LV FDR B 315A	1808	0.448	
LV FDR B 315A [BS88: Part-5]		1.286	0.838

Canefields Ave (332853) and Letherton Close (332770) Study 08


Phase fault at ServCable_A1: 888.637A, Earth fault at ServCable_A1: 888.637A - curves plotted at 0.433kV

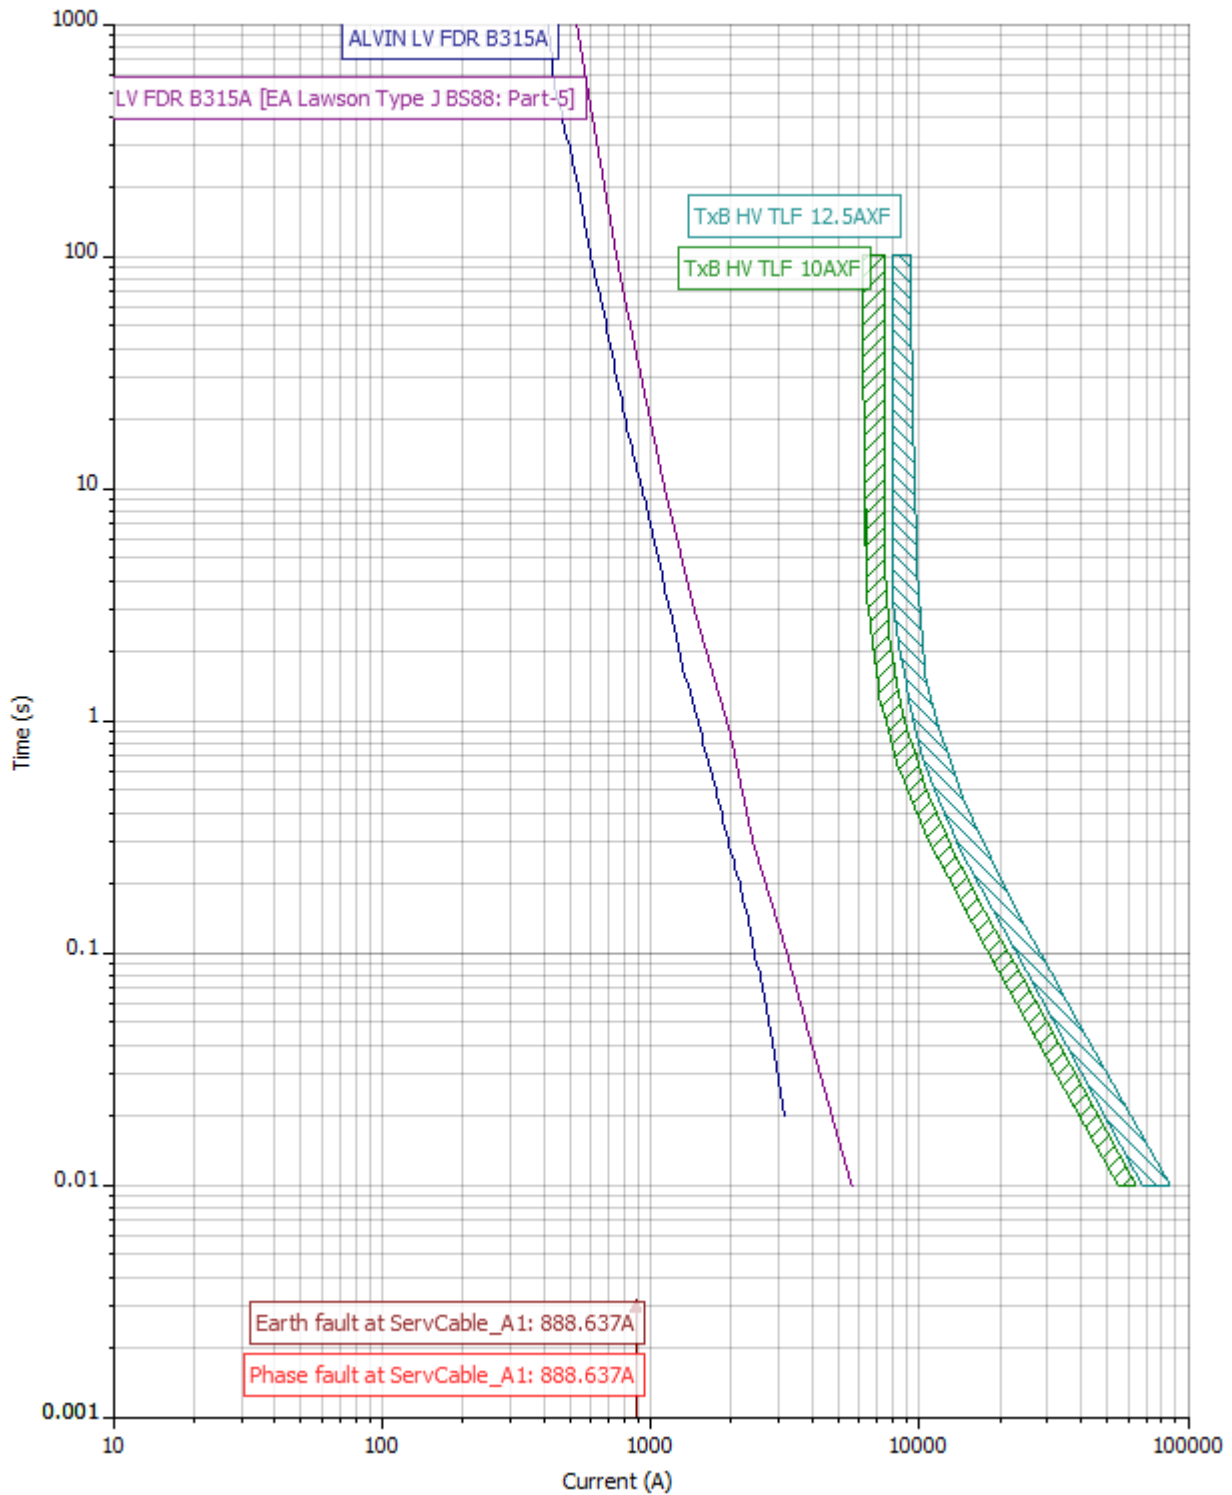

Protection Device	Current Seen (A)	Time (s)	Delta (s)
ALVIN LV FDR B 315A	889	12.273	
LV FDR B 315A [BS88: Part-5]		36.820	24.548

Canefields Ave (332853) and Letherton Close (332770) Study 09a

Phase fault at LV_Branch_A1: 3285.07A - curves plotted at 0.433kV

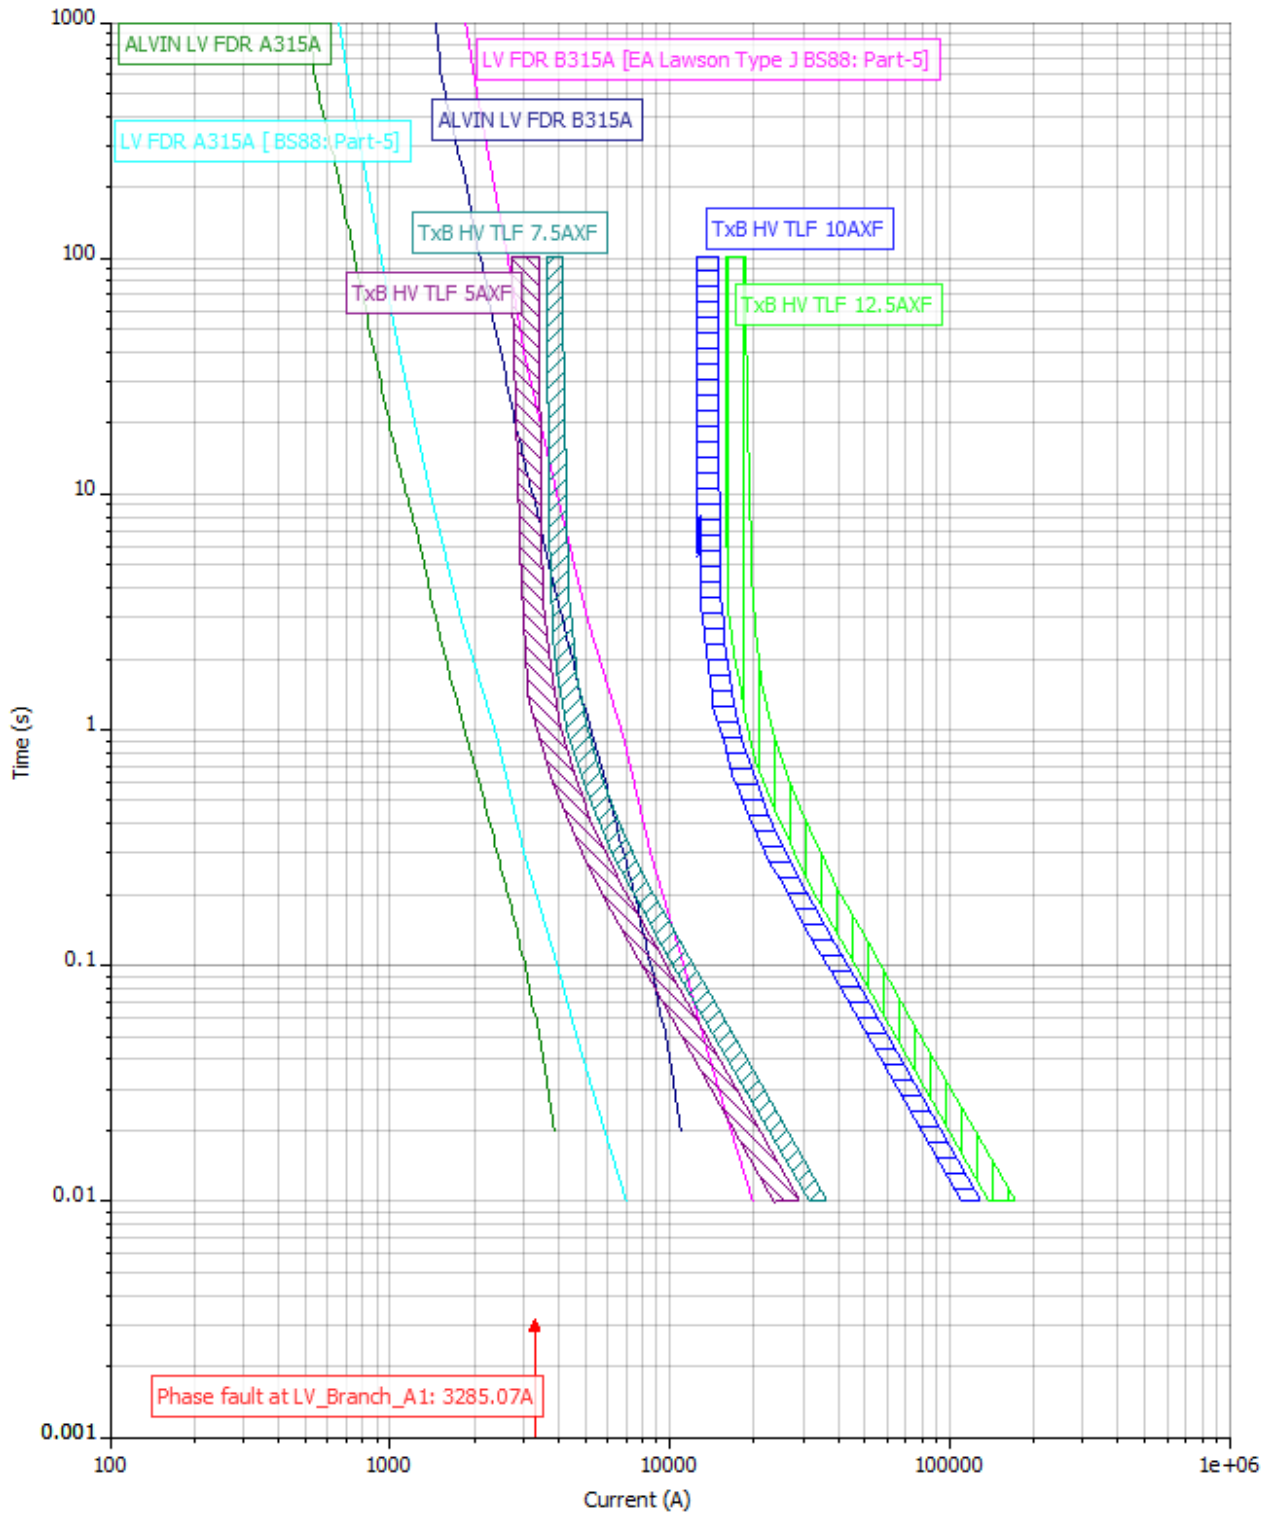


Phase fault at LV_Branch_A1: 3285.07A

Protection Device	Current Seen (A)	Time (s)	Delta (s)
ALVIN LV FDR A315A	3285	0.066	
LV FDR A315A [BS88: Part-5]		0.215	0.149

Canefields Ave (332853) and Letherston Close (332770) Study 09b

Phase fault at LV_Branch_A1: 1808.39A - curves plotted at 0.433kV

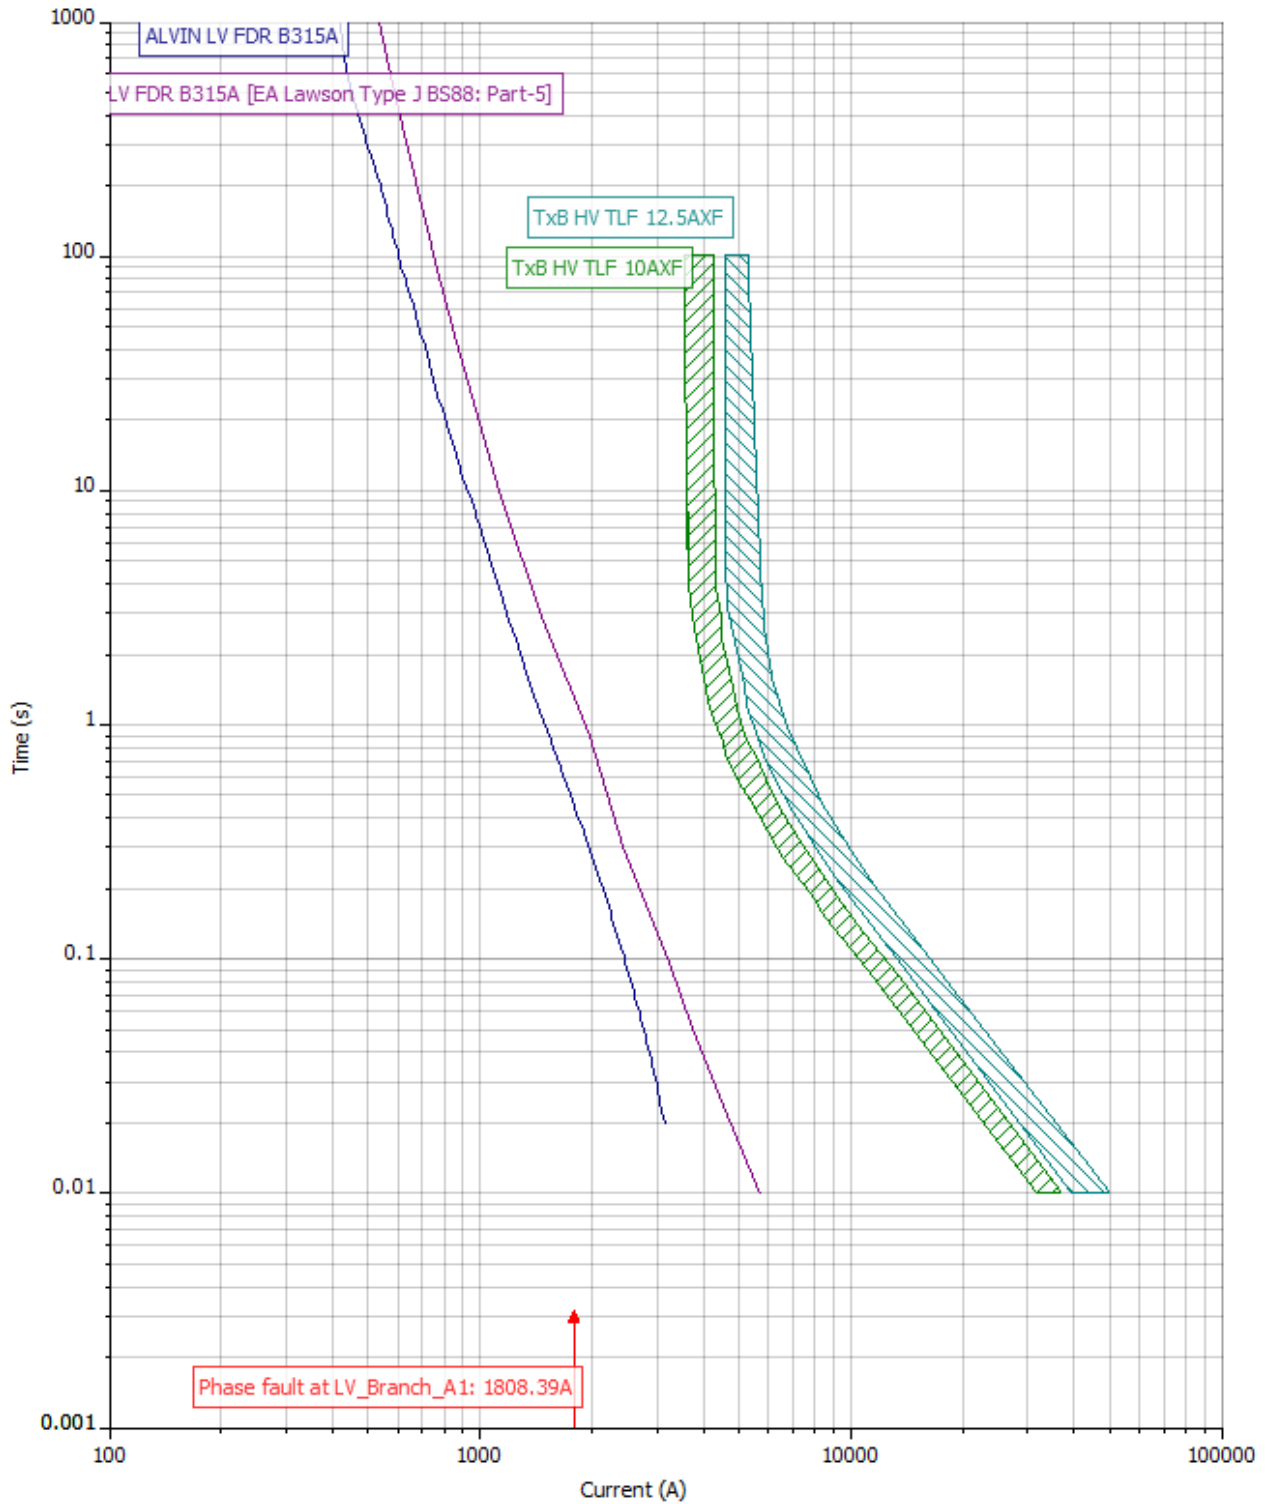


Phase fault at LV_Branch_A1: 1808.39A

Protection Device	Current Seen (A)	Time (s)	Delta (s)
ALVIN LV FDR B 315A	1808	0.448	
LV FDR B 315A [BS88: Part-5]		1.286	0.838

Canefields Ave (332853) and Letherton Close (332770) Study 10a

Phase fault at LV_Branch_B2: 3347A - curves plotted at 0.433kV

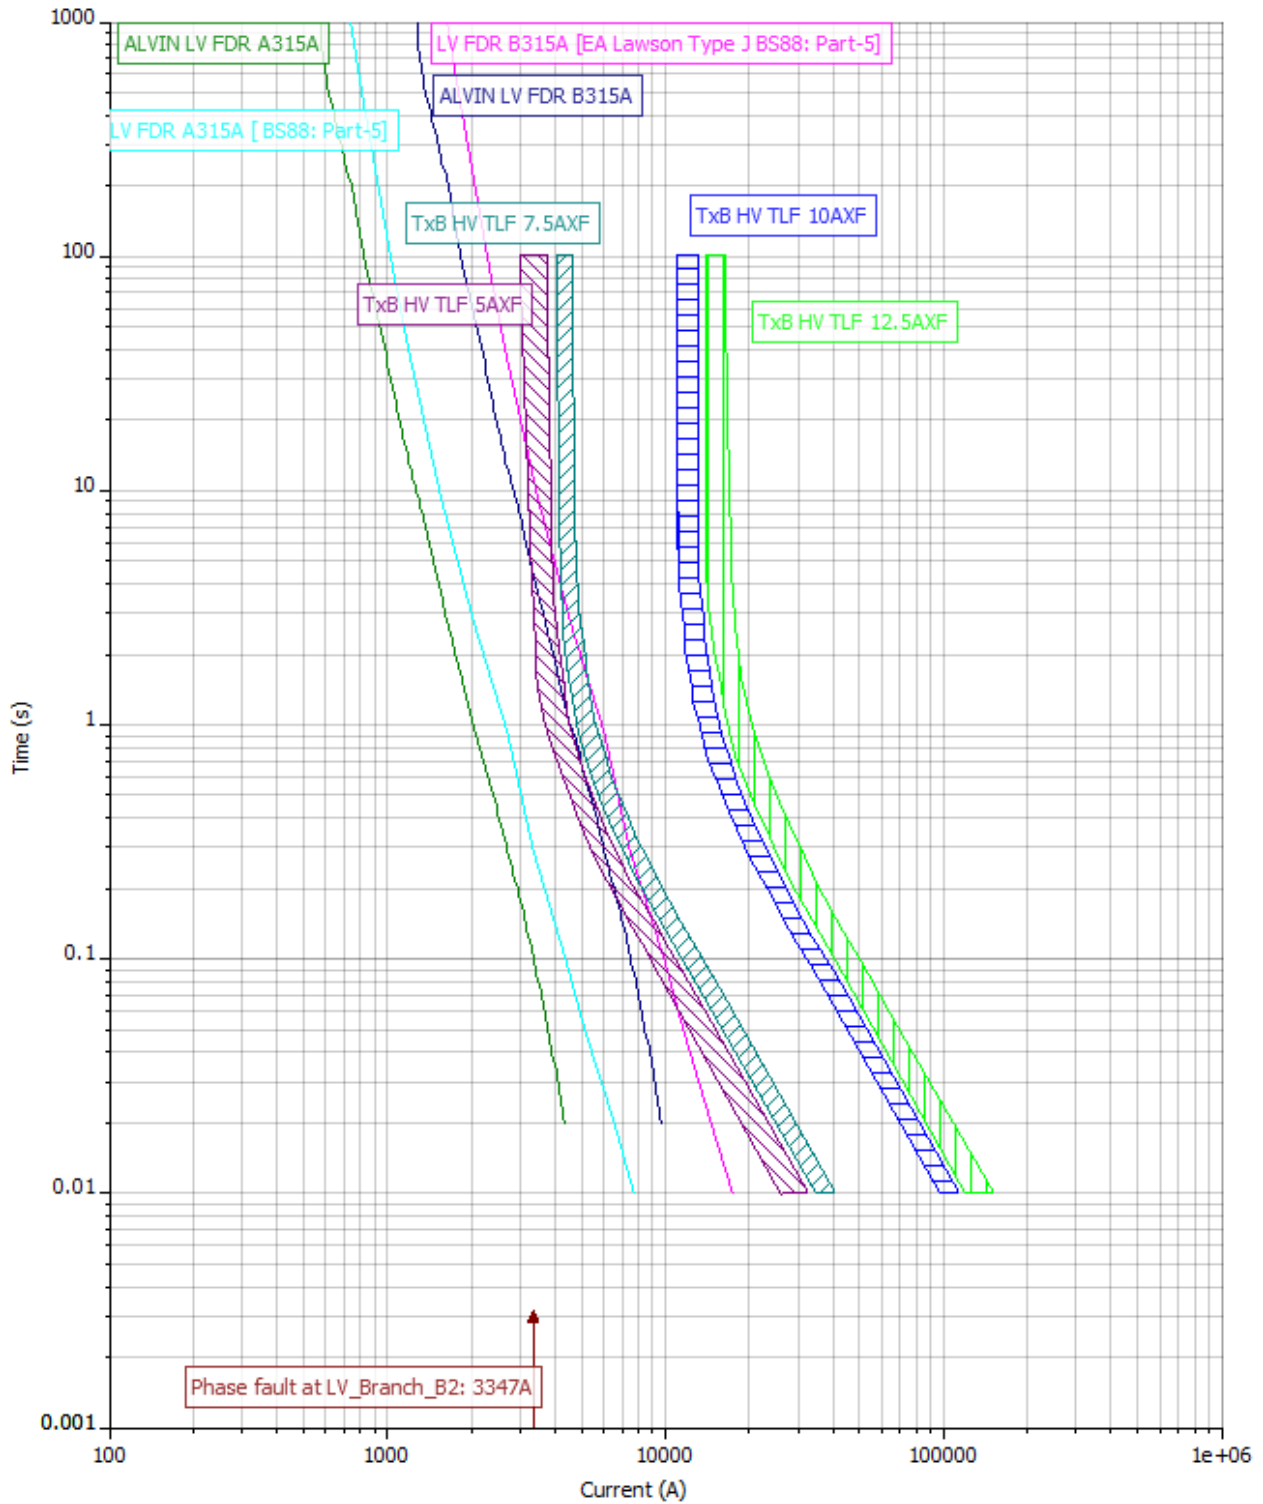


Phase fault at LV_Branch_B2: 3347A


Protection Device	Current Seen (A)	Time (s)	Delta (s)
ALVIN LV FDR A 315A	3347	0.106	
LV FDR A 315A [BS88: Part-5]		0.303	0.197

Canefields Ave (332853) and Letherton Close (332770) Study 10b

Phase fault at LV_Branch_B2: 1989.17A - curves plotted at 0.433kV

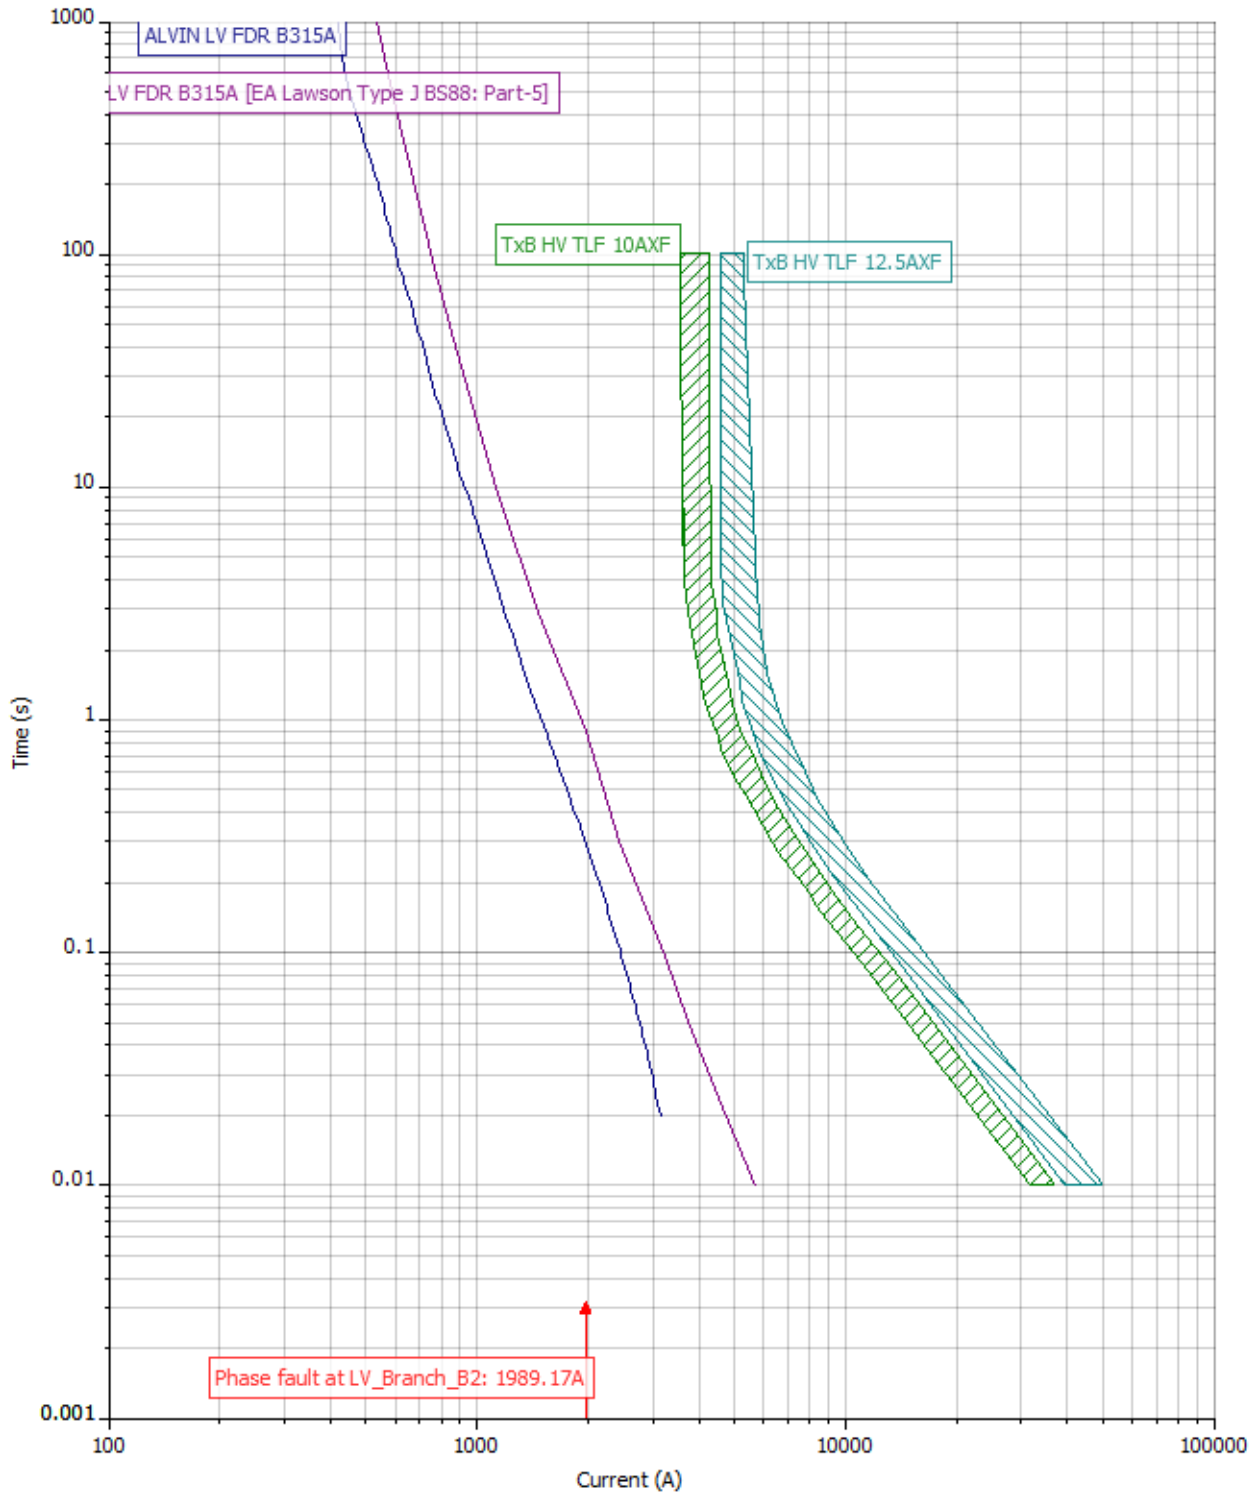


Protection Device	Current Seen (A)	Time (s)	Delta (s)
ALVIN LV FDR B 315A	1989	0.286	
LV FDR B 315A [BS88: Part-5]		0.872	0.586

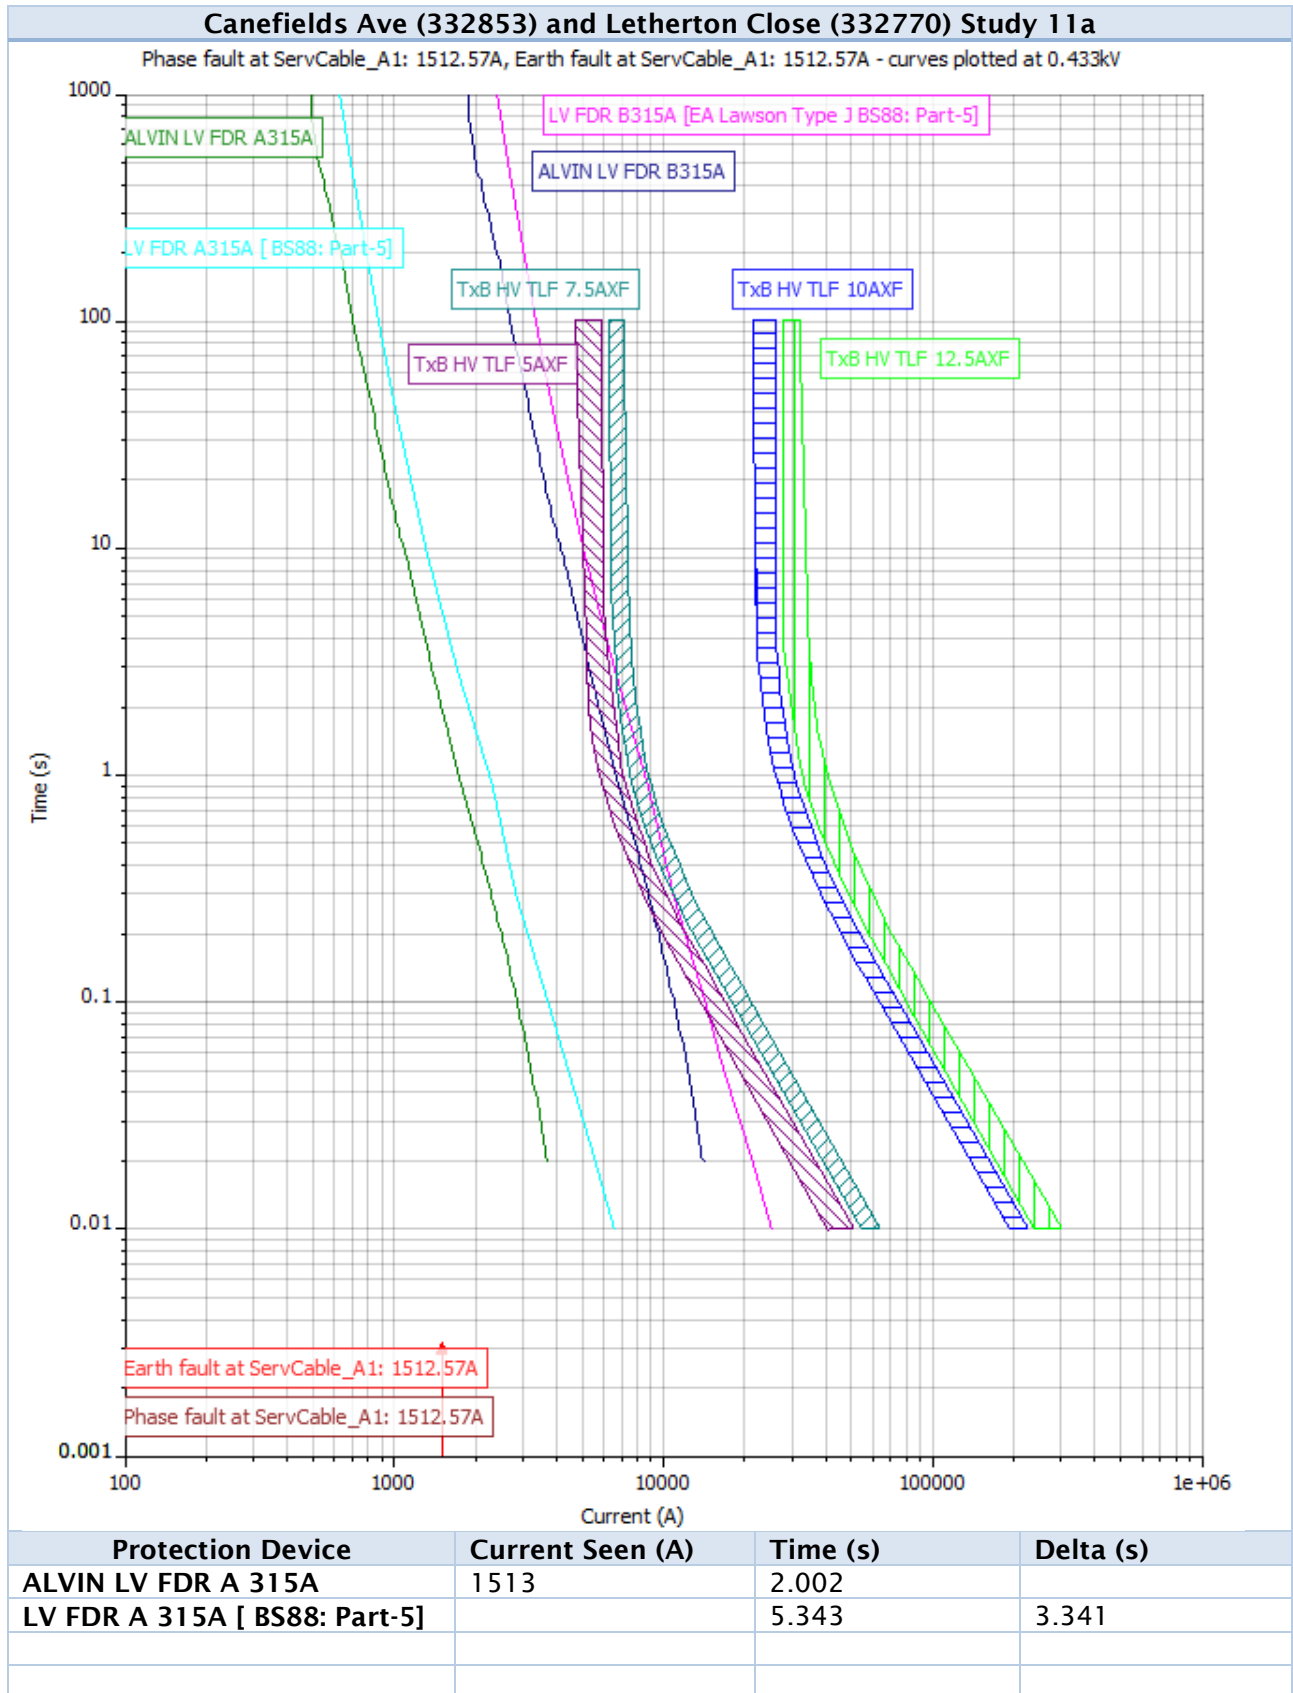

Canefields Ave (332853) and Letherton Close (332770) Study 11b

Phase fault at ServCable_A1: 888.637A, Earth fault at ServCable_A1: 888.637A - curves plotted at 0.433kV

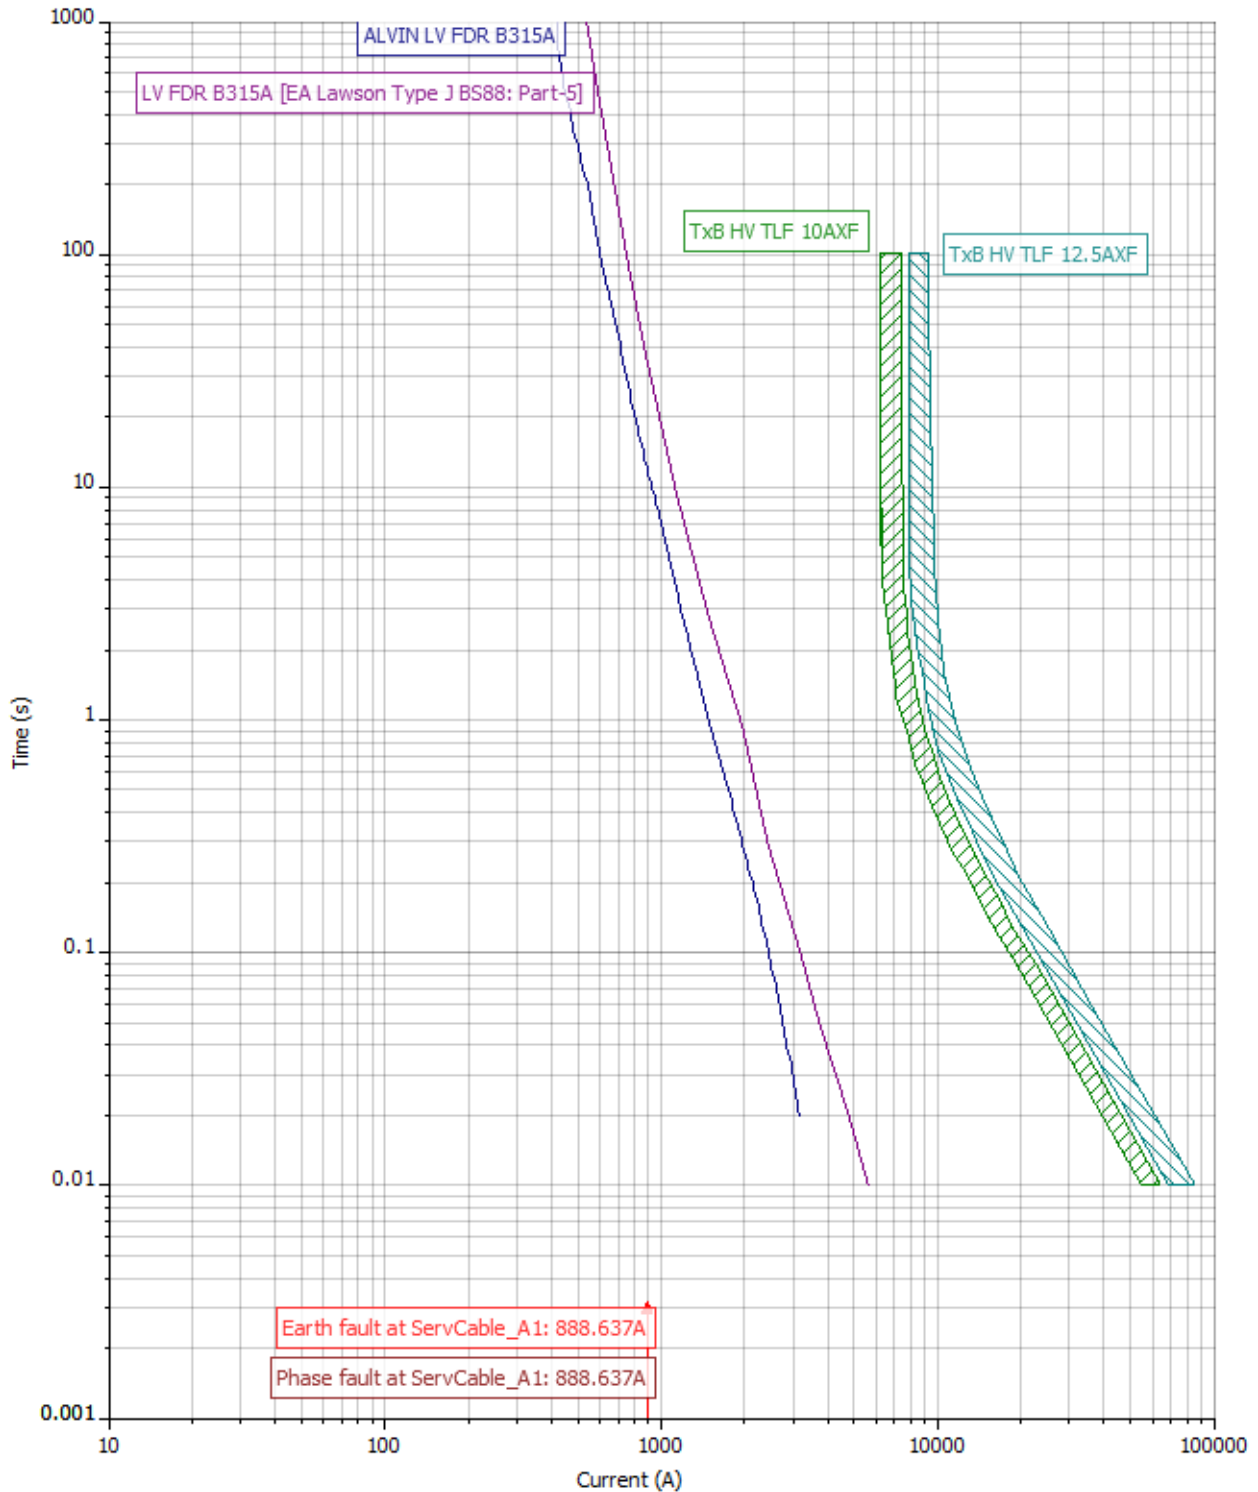

Protection Device	Current (A)	Seen	Time (s)	Delta (s)
ALVIN LV FDR B 315A	889		12.273	
LV FDR B 315A [BS88: Part-5]			36.820	24.548

